

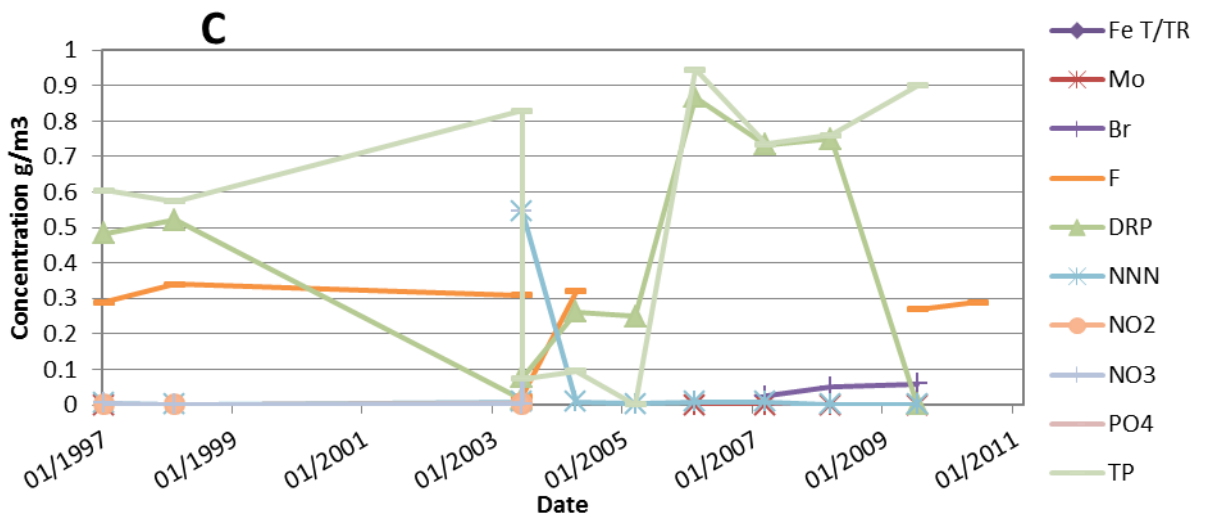
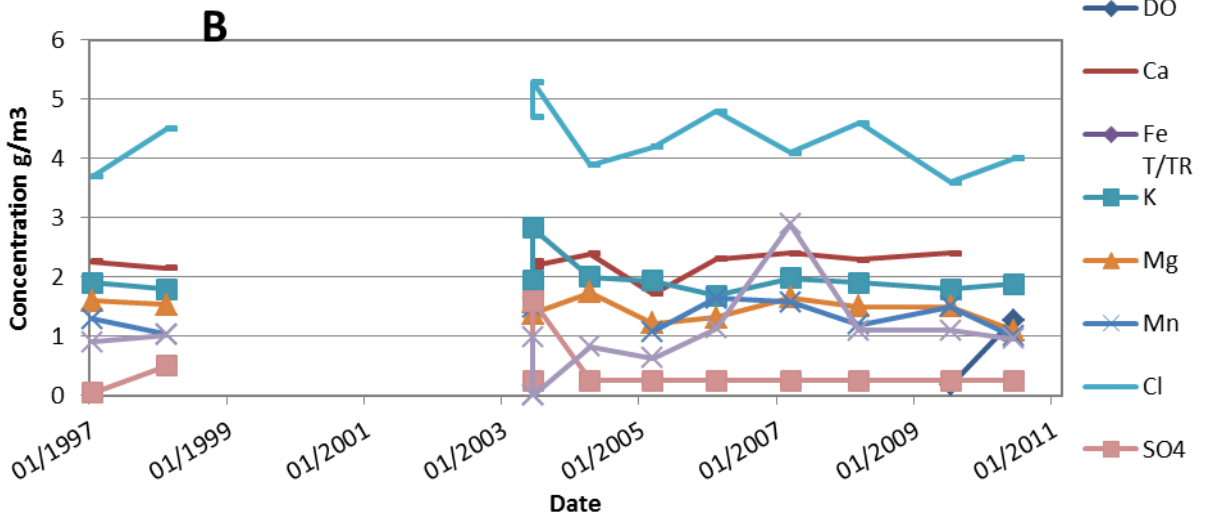


Bore 3470 water quality graphs



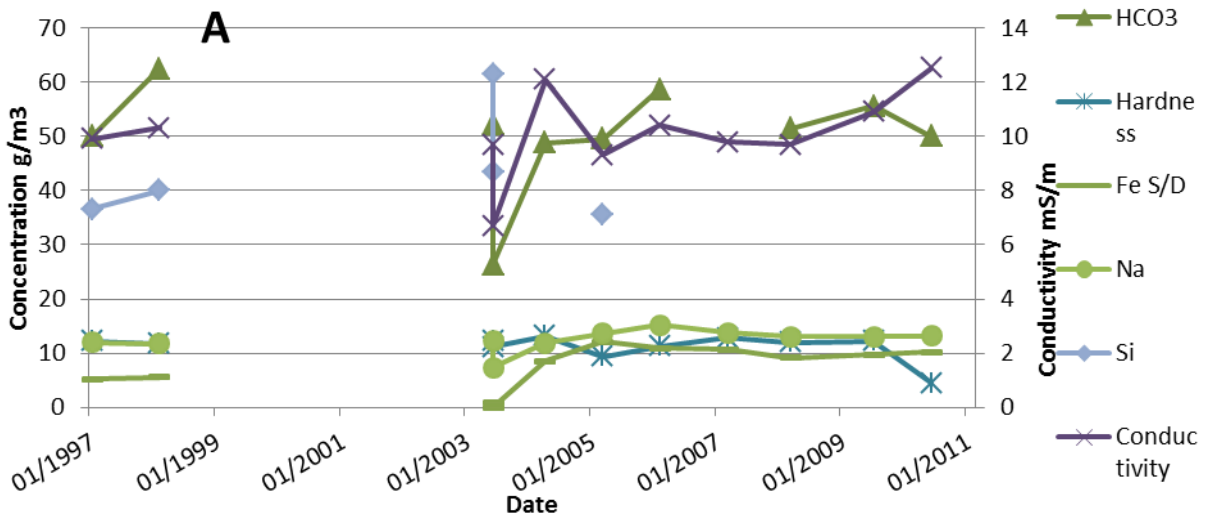


Bore 3566 Information			
Monitoring type	Water quality	Depth (m)	122
Name	Thacker	Casing Depth (m)	70
Bore use	Agricultural/Domestic	Screen/open hole	From 88? to 122
Easting	281 7258	Temperature	Cold water
Northing	636 5278	Catchment	Kaikokopu-Pokopoko-Wharere
Bore log	-	Aquifer	Tauranga sediments
Monitoring period	Water level	-	
	Water quality	1997 - 2011	LabStar: BOP180070

Bore 3566 geological profile (EBOF)

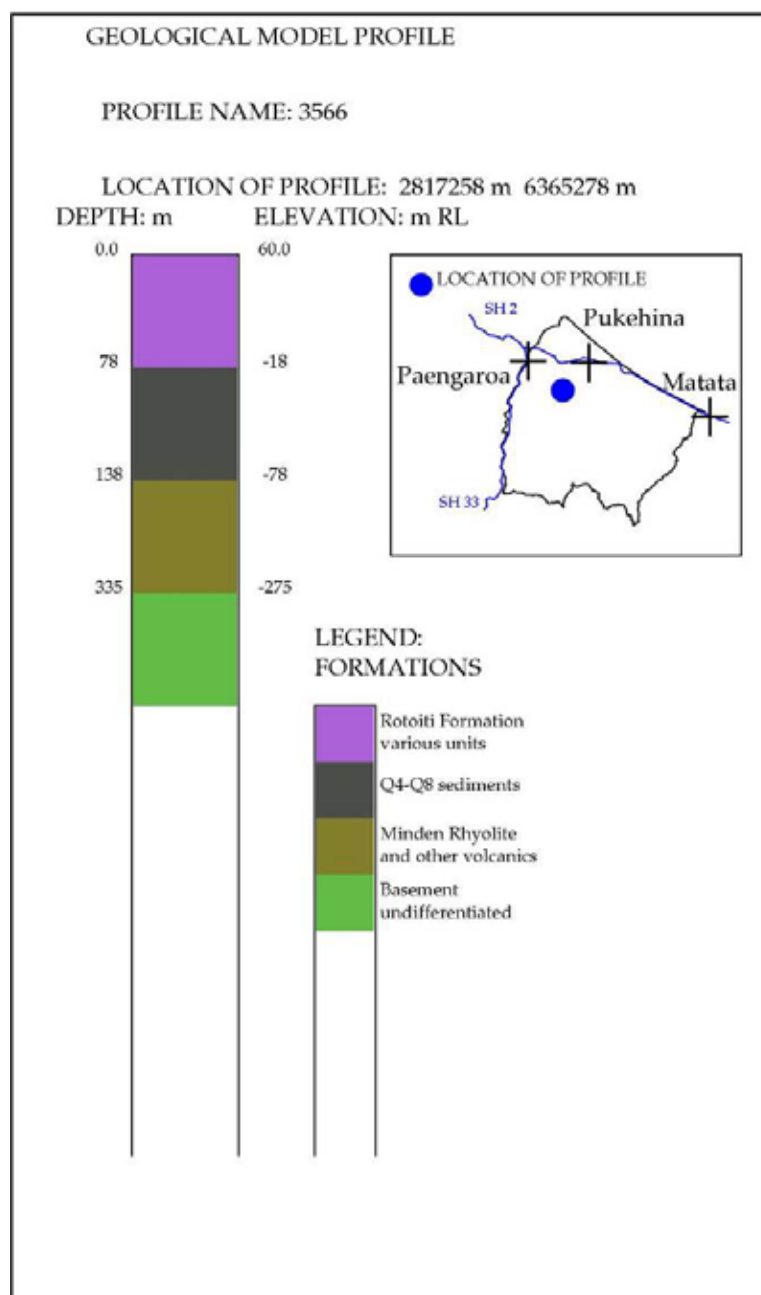


Bore 3566 water quality graphs

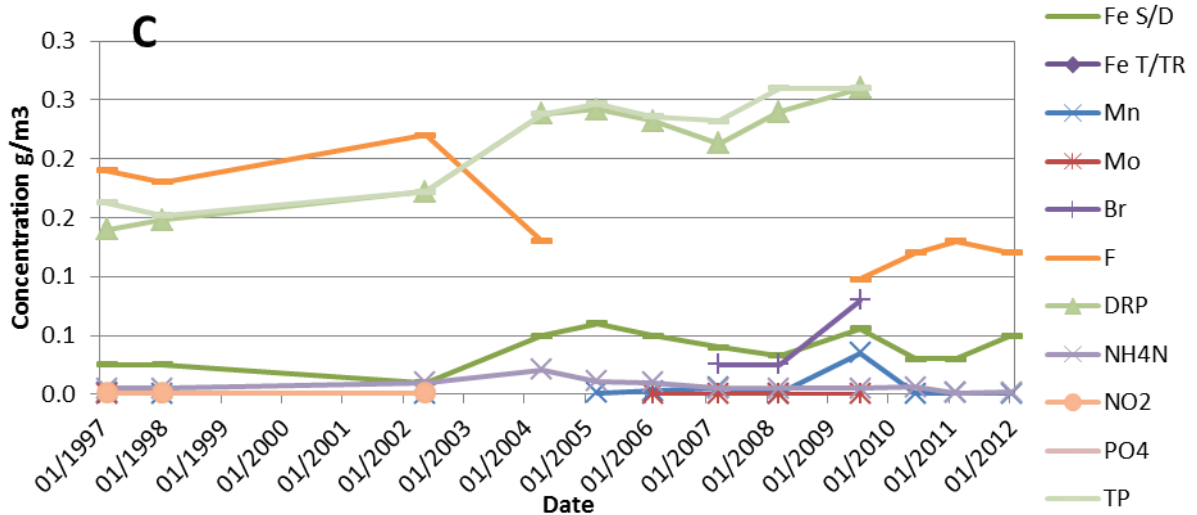
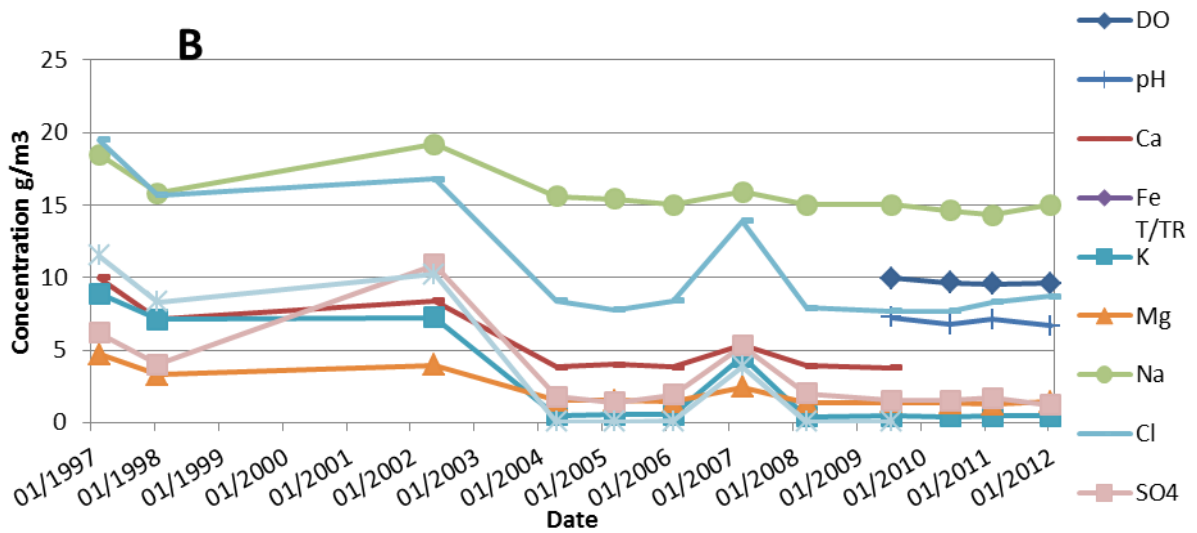
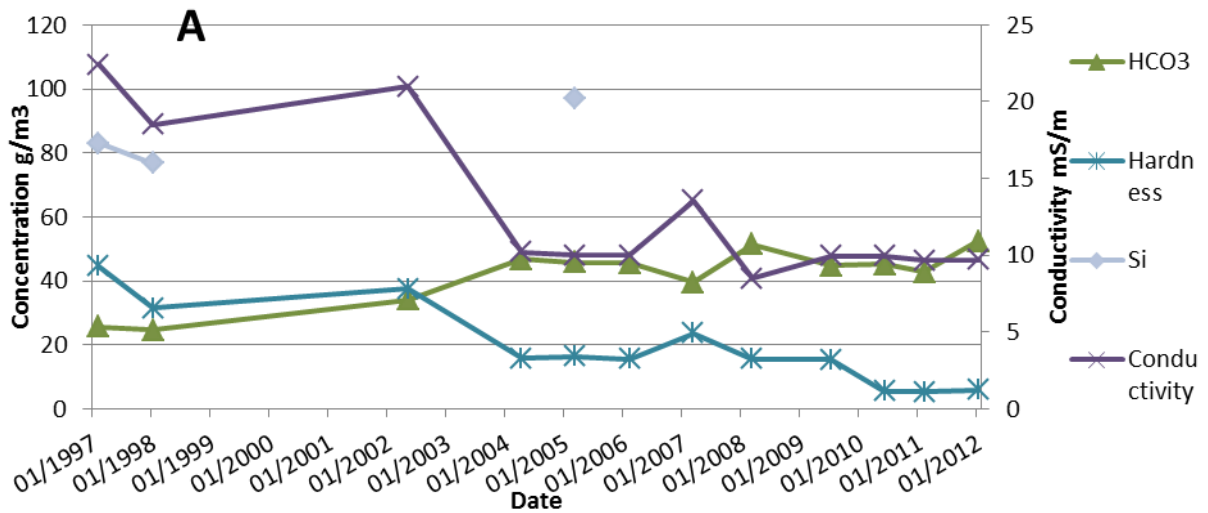


Bore 4000 Information			
Monitoring type	Water quality	Depth (m)	26
Name	Ludgate Hill	Casing Depth (m)	Unknown
Bore use	Irrigation	Screen/open hole	Unknown
Easting	2802640	Temperature	14°C
Northing	6343400	Catchment	Lake Rotorua
Bore log	–	Aquifer	Tauranga sediments
Monitoring period	Water level	-	
	Water quality	1991 to 1998	

Bore 4000 geological profile (EBOF)

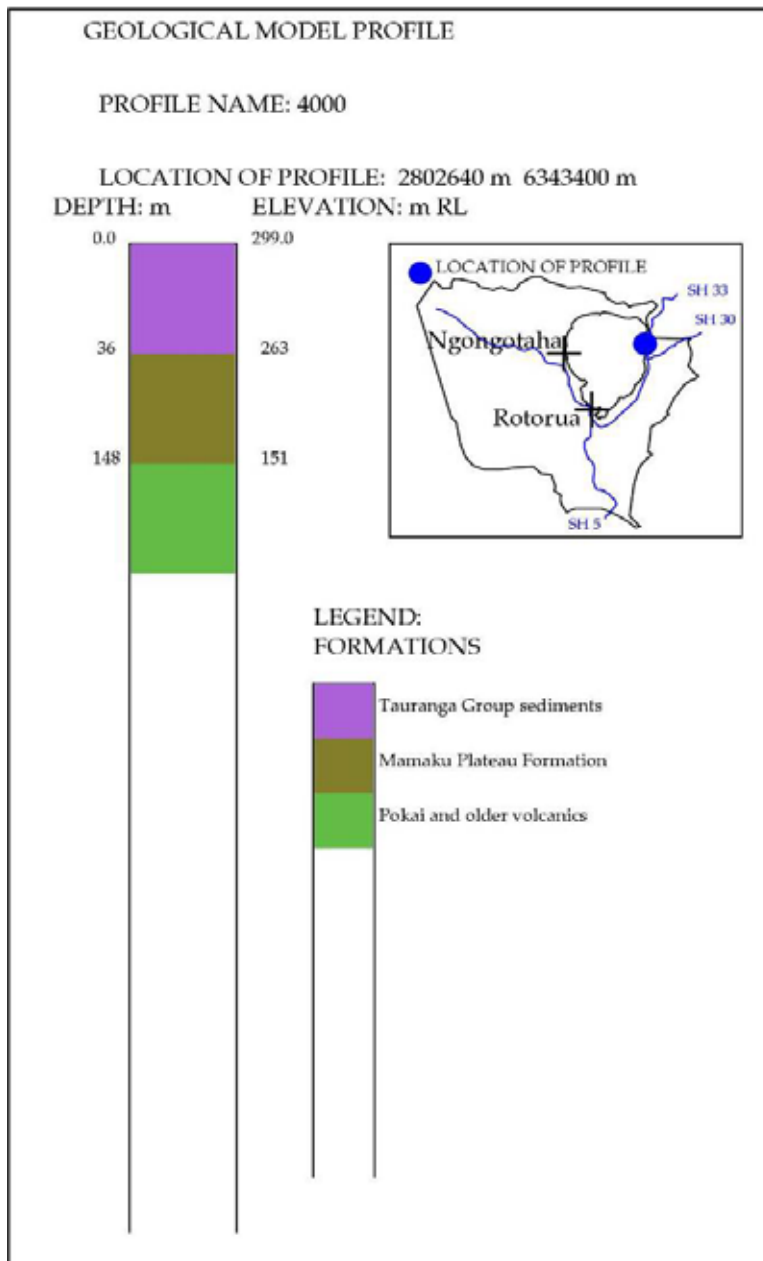




Bore 4000 water quality graphs

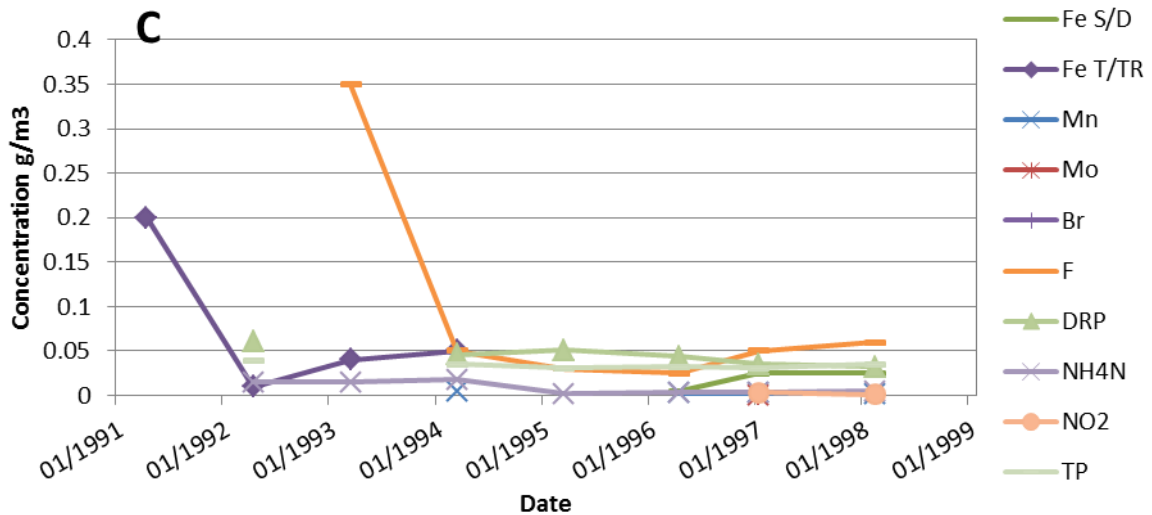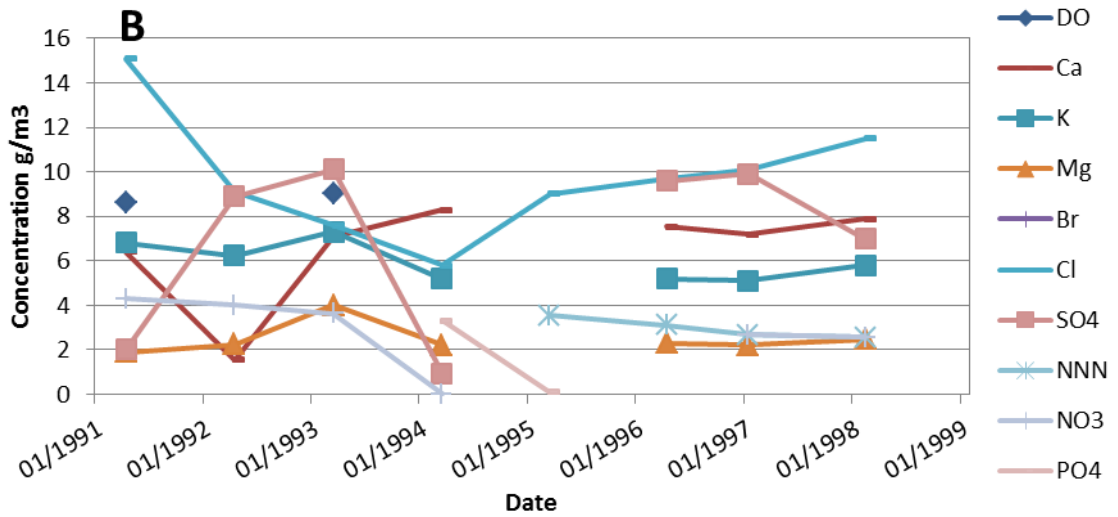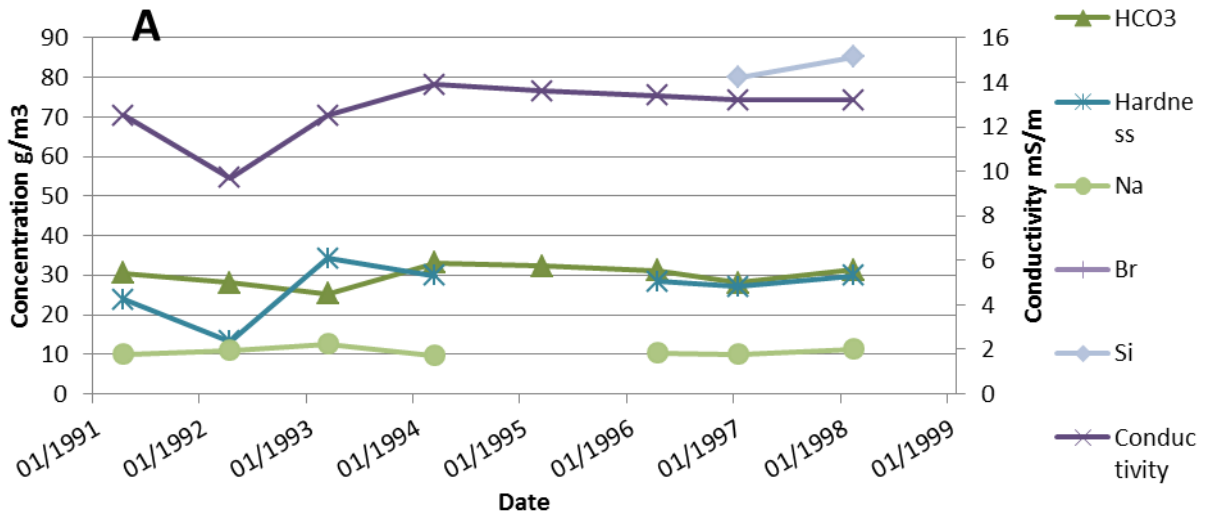

Bore 4001 Information			
Monitoring type	Water quality	Depth (m)	55
Name	Rotomā Holiday Camp	Casing Depth (m)	Unknown
Bore use	Swimming pool	Screen/open hole	Unknown
Easting	282 1500	Temperature	40°C
Northing	634 5100	Catchment	Lake Rotoehu
Bore log	–	Aquifer	Tauranga sediments
Monitoring period	Water level	-	
	Water quality	1991 to 2009	

The Earth Beneath our Feet model is not currently available for this bore.




Bore 4001 water quality graphs

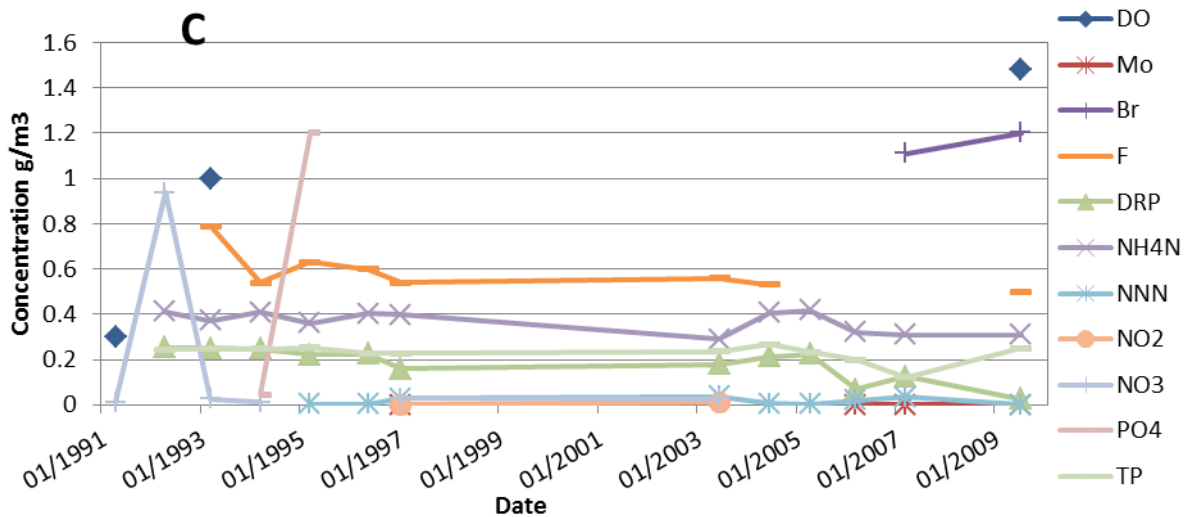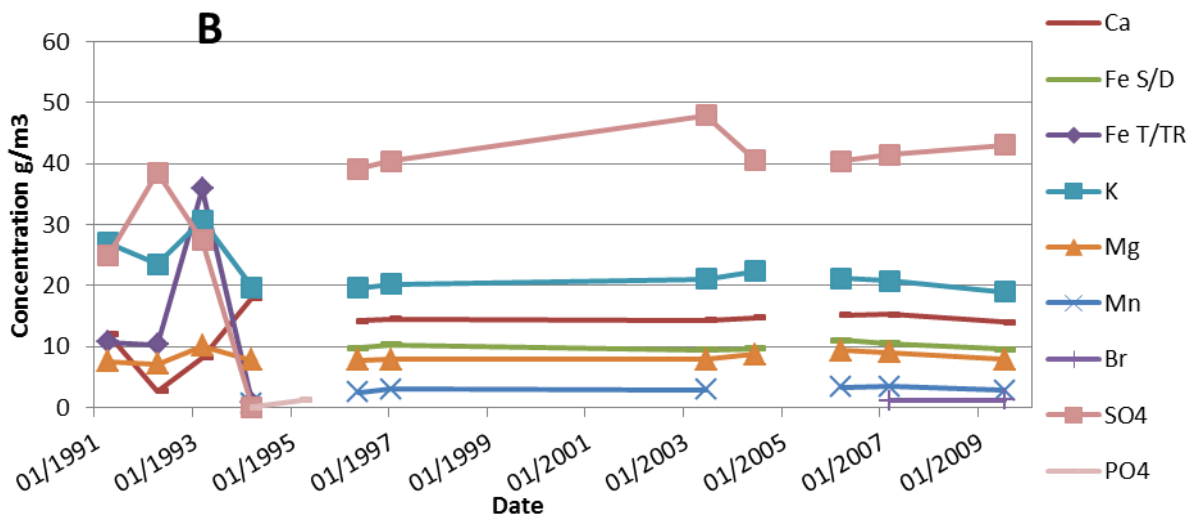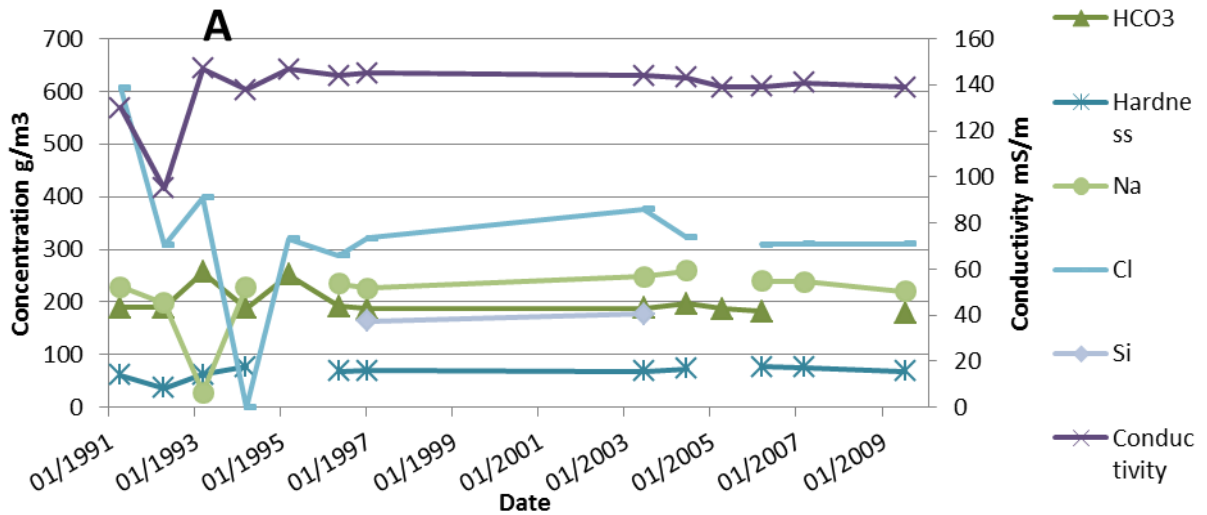

Bore 4002 Information			
Monitoring type	Water quality	Depth (m)	60
Name	Ōpōtiki Holiday Park	Casing Depth (m)	Unknown
Bore use	Unknown	Screen/open hole	Unknown
Easting	288 6200	Temperature	16.5°C
Northing	634 6600	Catchment	Opotiki Plains
Bore log	-	Aquifer	Tauranga Group Sediments
Monitoring period	Water level		
	Water quality	1991 to 2009	LabStar: BOP180029


The Earth Beneath our Feet model is not currently available for this region.

Bore 4002 water quality graphs

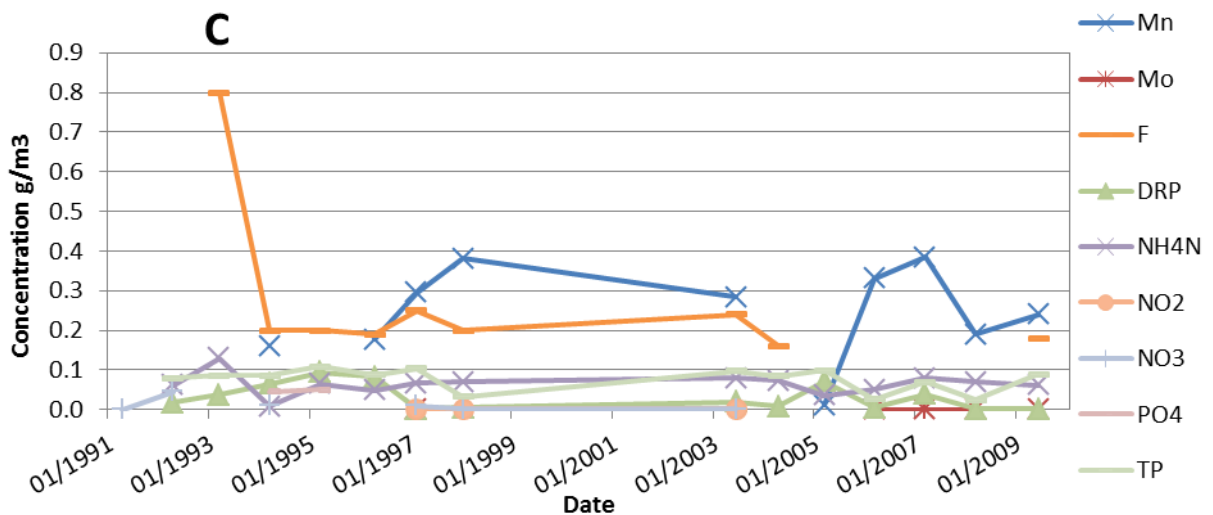
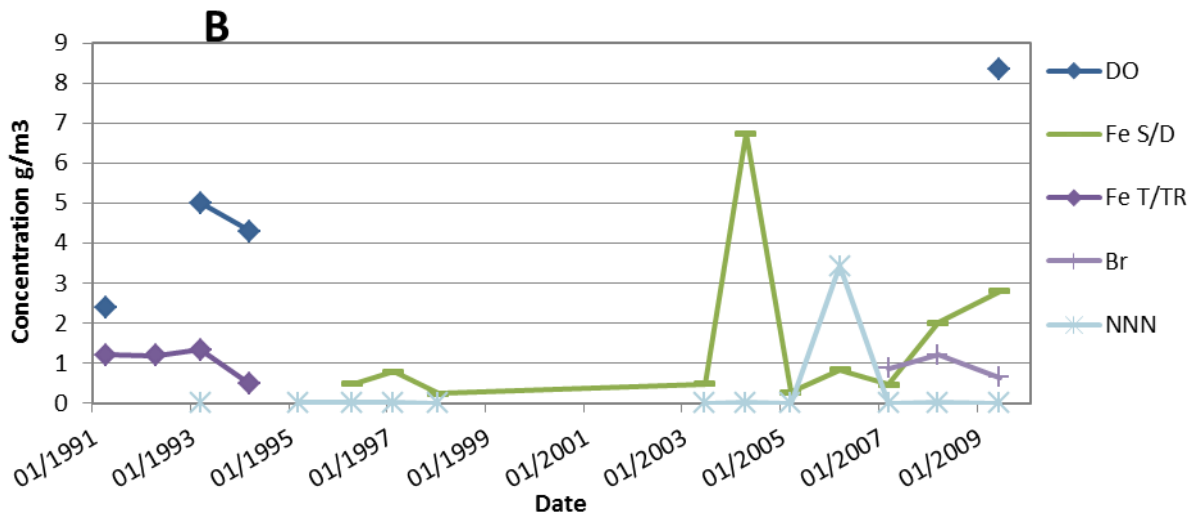
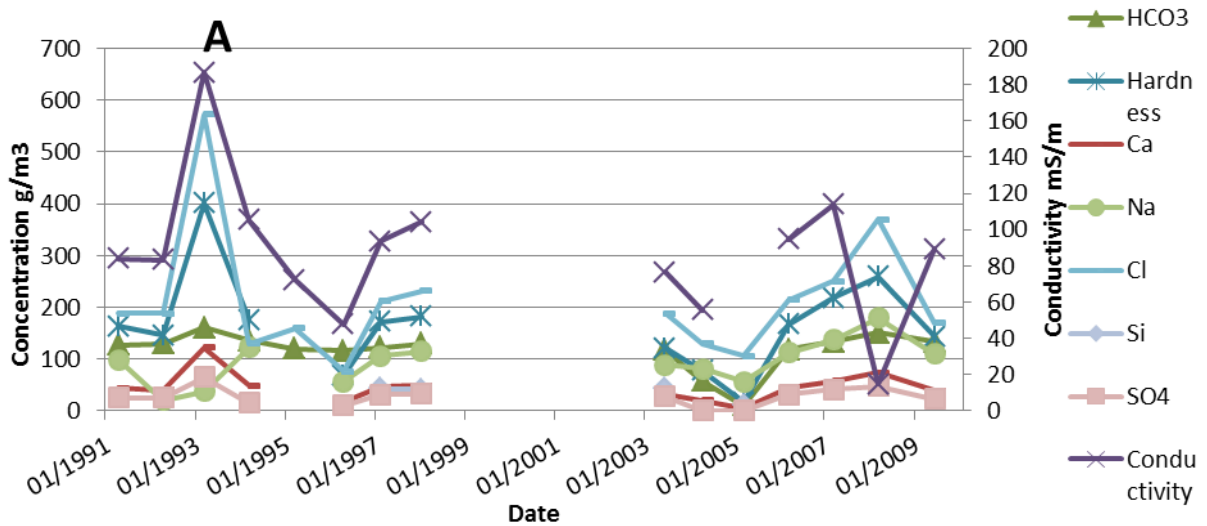


Bore 4003 Information			
Monitoring type	Water quality	Depth (m)	26
Name	Ludgate Hill	Casing Depth (m)	Unknown
Bore use	Domestic	Screen/open hole	Unknown
Easting	280 2530	Temperature	Unknown
Northing	634 3420	Catchment	Lake Rotorua
Bore log	–	Aquifer	Tauranga sediments
Monitoring period	Water level	-	
	Water quality	2003 to 2008	

Bore 4003 geological profile (EBOF)

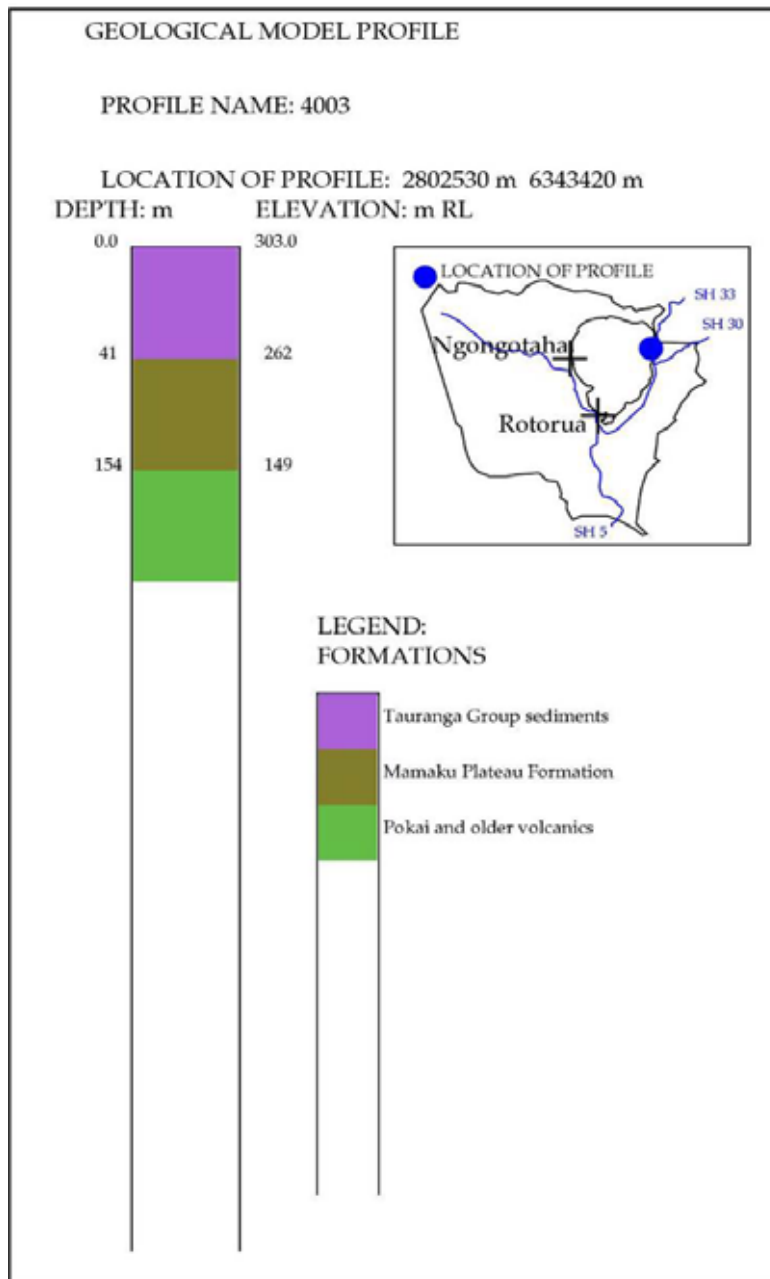


Bore 4003 water quality graphs

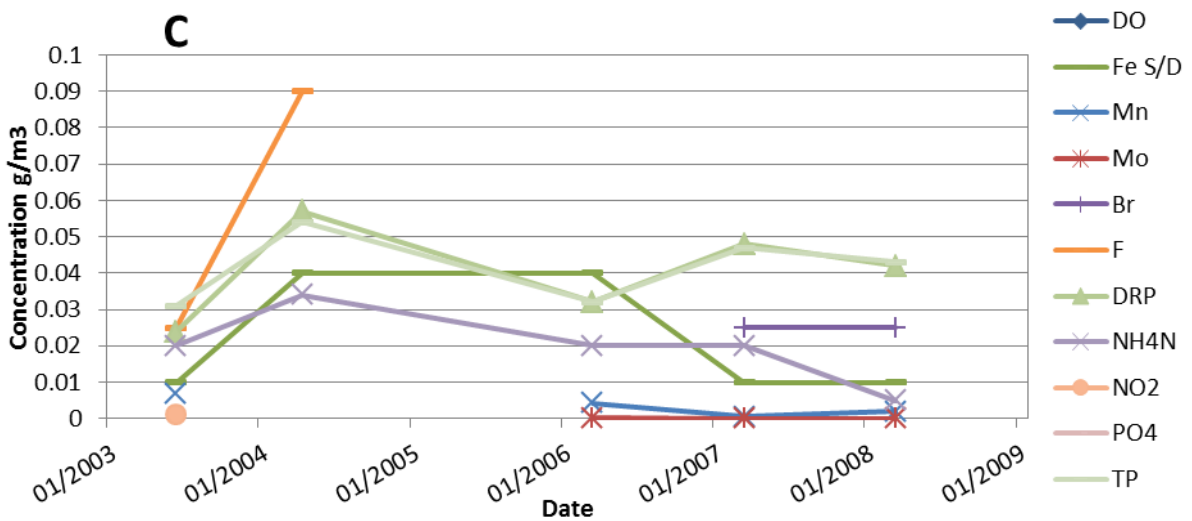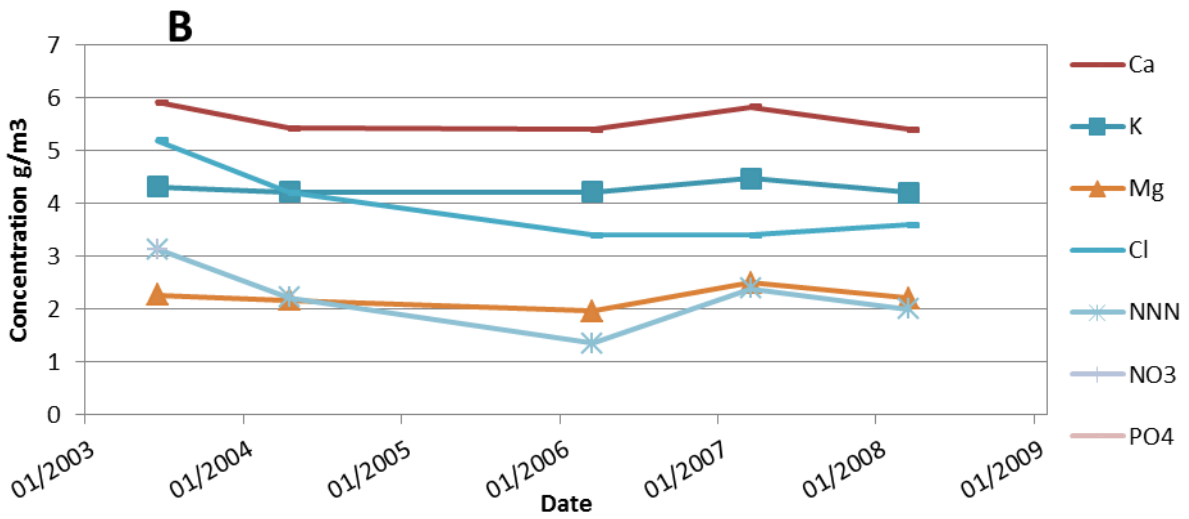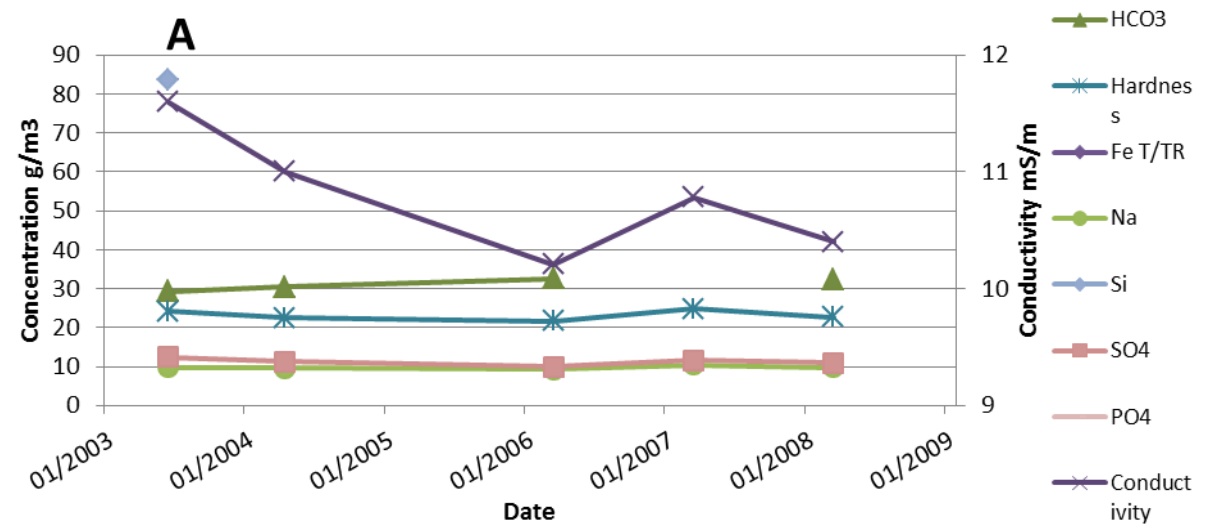


Bore 4005 Information			
Monitoring type	Water level	Depth (m)	180
Name	Geiss	Casing Depth (m)	167
Bore use	Irrigation/domestic	Screen/open hole	Unknown
Easting	280 3318	Temperature	Unknown
Northing	634 0128	Catchment	Rotokawa (Lake Rotorua)
Bore log	–	Aquifer	Tauranga sediments
Monitoring period	Water level	1995 to 2011	
	Water quality	-	

Bore 4005 geological profile (EBOF)

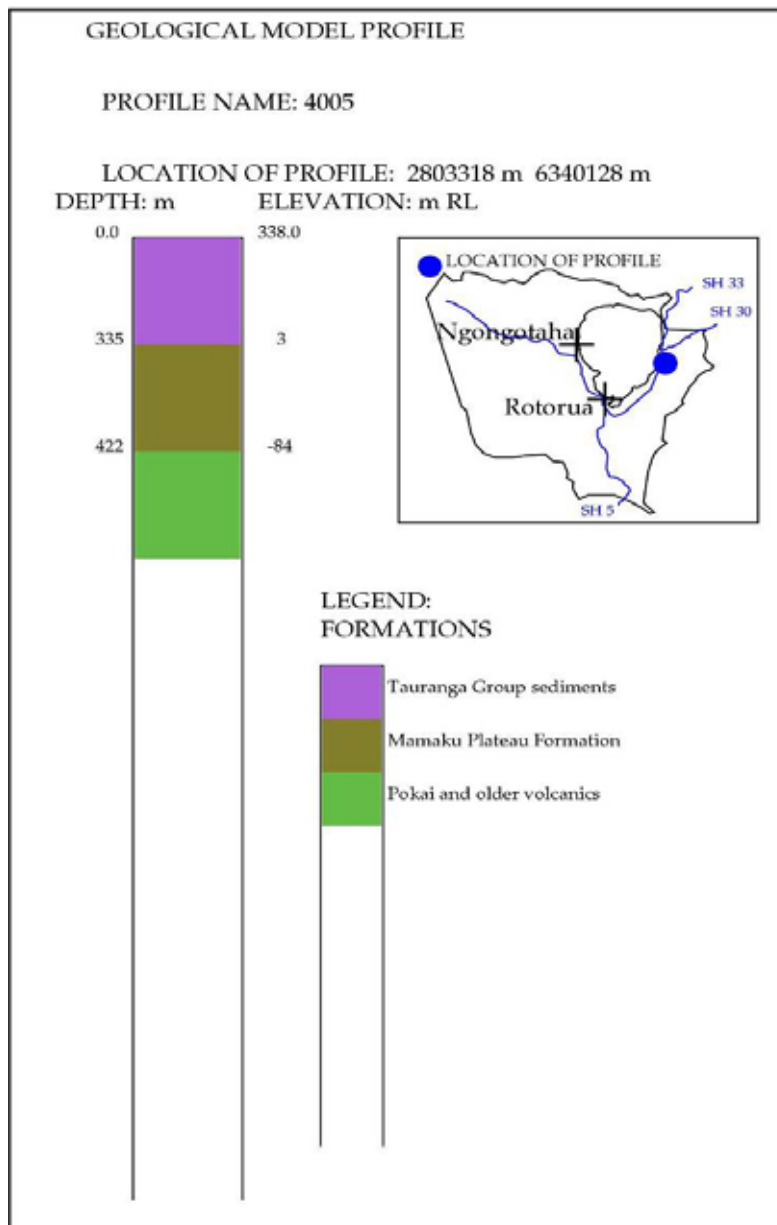


Bore 4005 water level graphs

Bore 4005 Raw data

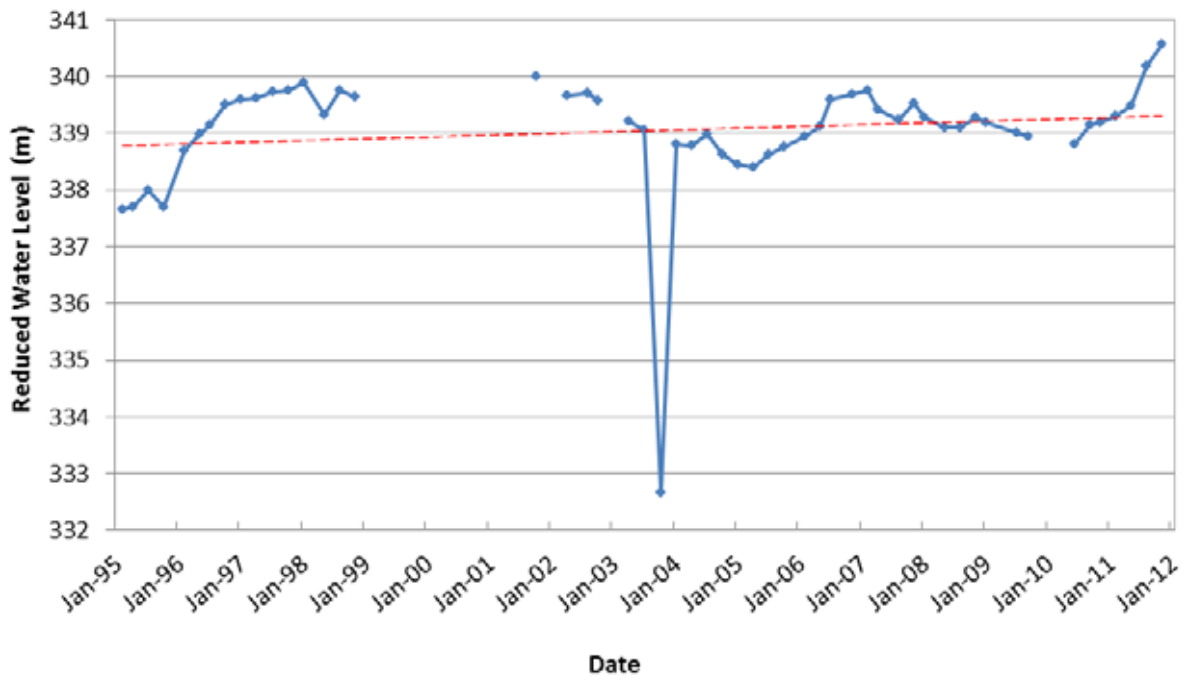


Bore 4005 Edited data

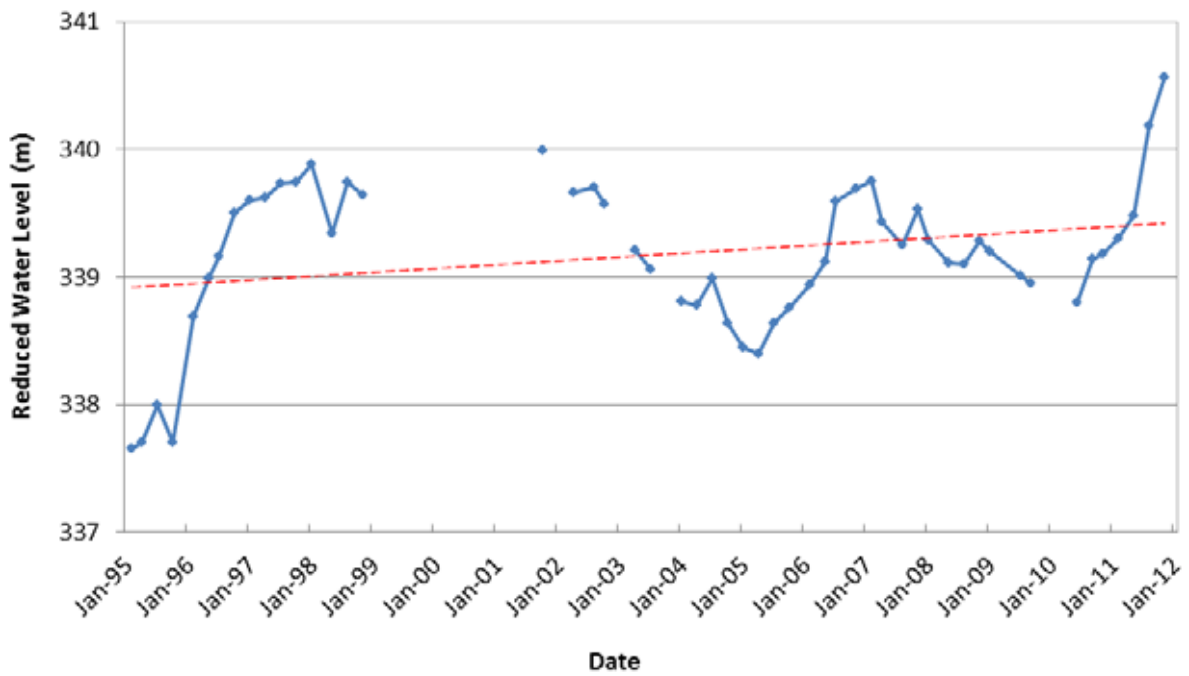


Bore 4006 Information			
Monitoring type	Water level	Depth (m)	85.3
Name	Field	Casing Depth (m)	Unknown
Bore use	Irrigation	Screen/open hole	Unknown
Easting	279 1006	Temperature	Unknown
Northing	634 3963	Catchment	Waimehia (Lake Rotorua)
Bore log	-	Aquifer	Tauranga sediments
Monitoring period	Water level	1995 to 2011	
	Water quality		

Bore 4006 geological profile (EBOF)

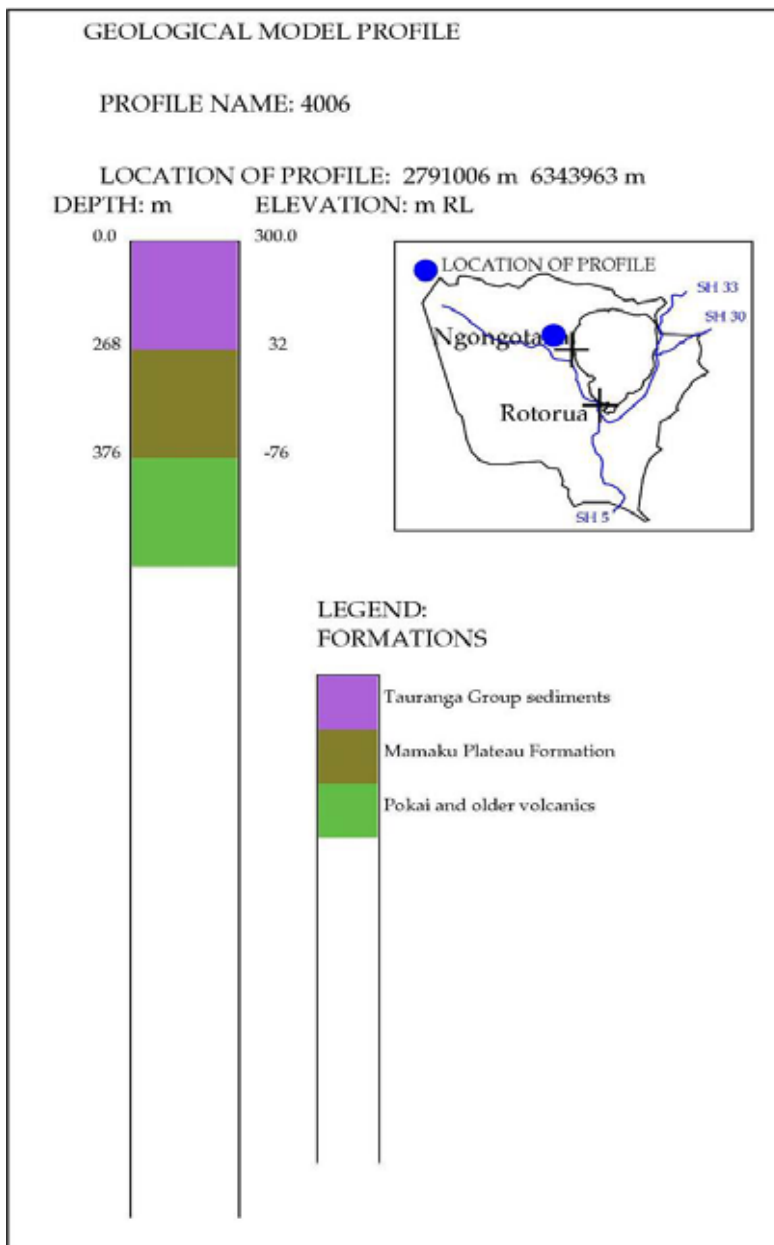


Bore 4006 water level graphs

Bore 4006 Raw data

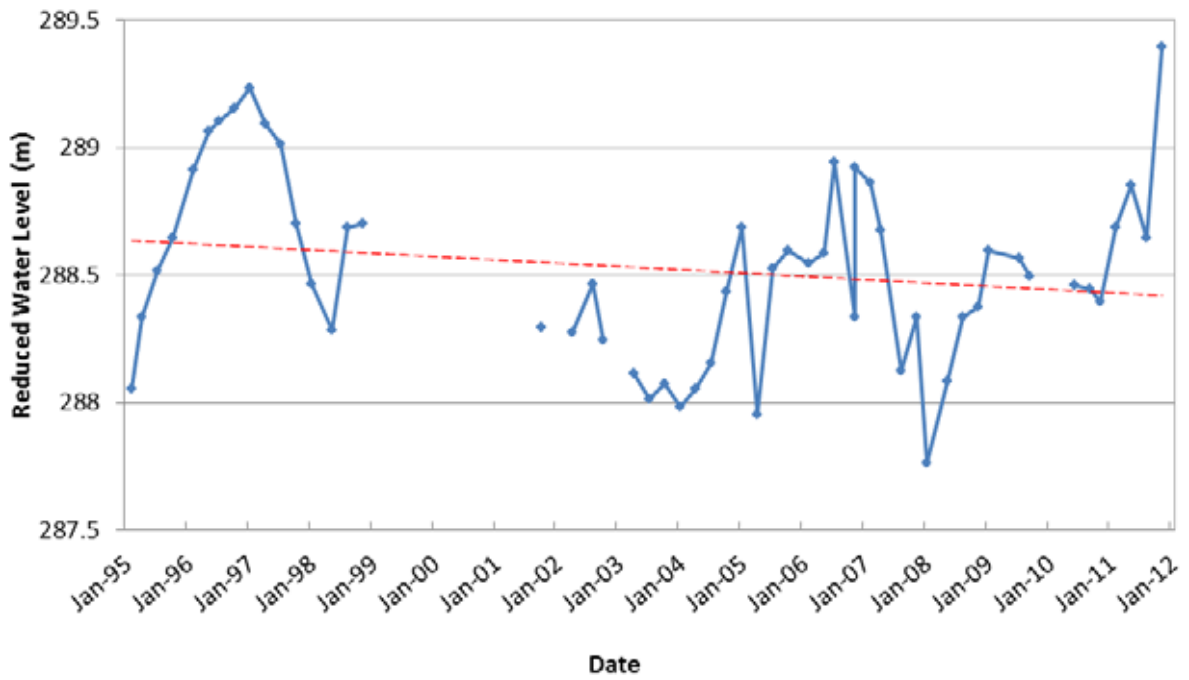


Bore 4006 Edited data

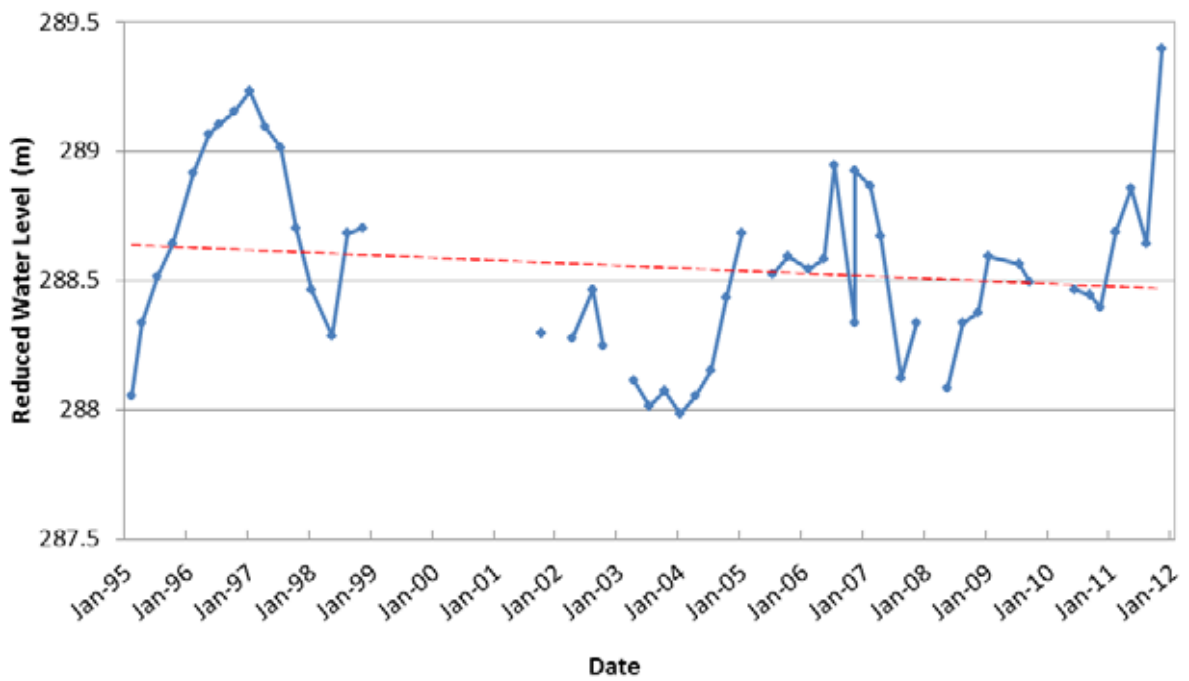


Bore 4007 Information			
Monitoring type	Water level & Water quality	Depth (m)	Unknown
Name	Pemberton	Casing Depth (m)	Unknown
Bore use	Lifestyle block/Domestic	Screen/open hole	Open hole
Easting	278 9325	Temperature	12.7°C
Northing	634 4683	Catchment	Waimehia (Lake Rotorua)
Bore log	-	Aquifer	Pokai and other volcanics
Monitoring period	Water level	1995 to 2011	
	Water quality	1996 to 2011	LabStar: BOP180061

Bore 4007 geological profile (EBOF)

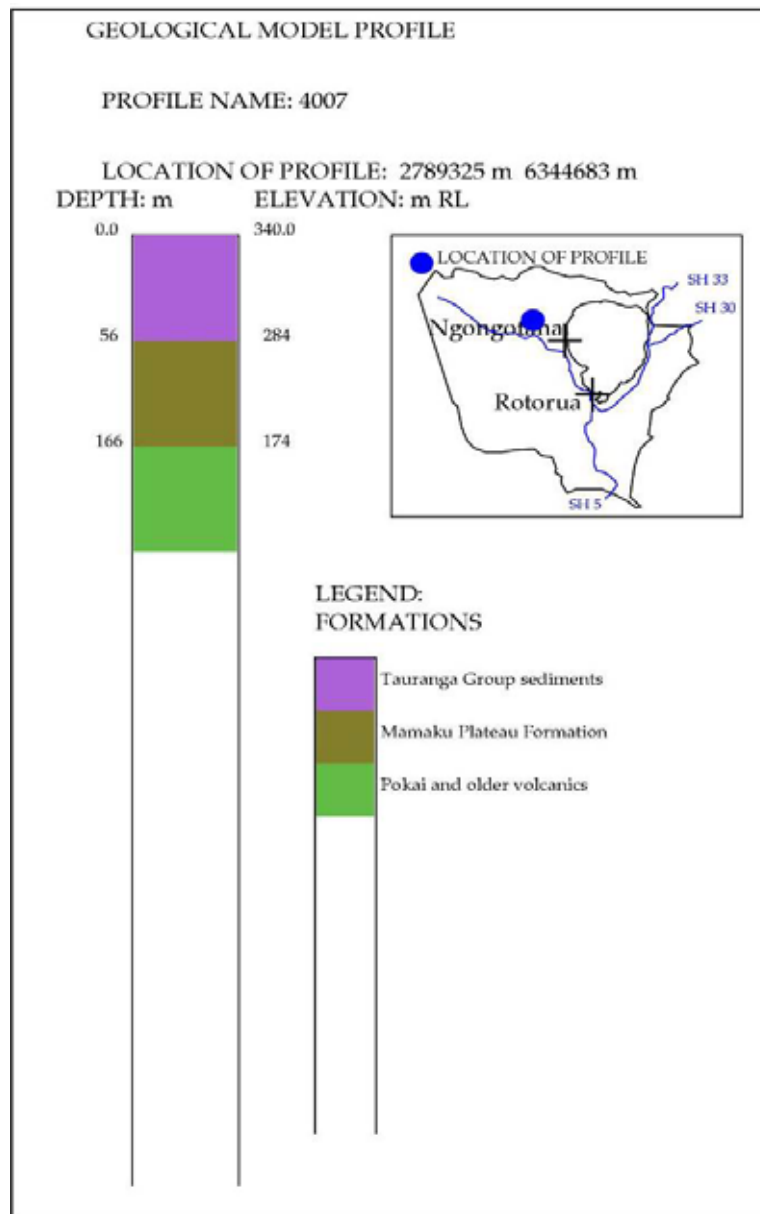


Bore 4007 water level graphs




Bore 4007 Raw data

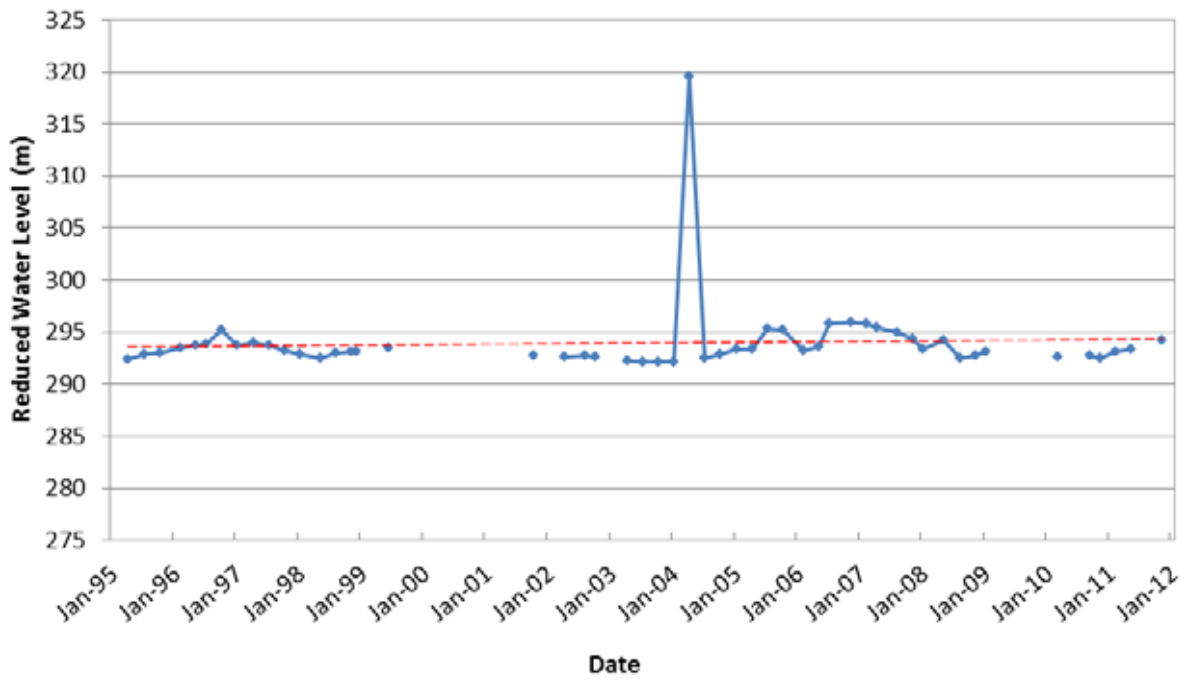

Bore 4007 Edited data

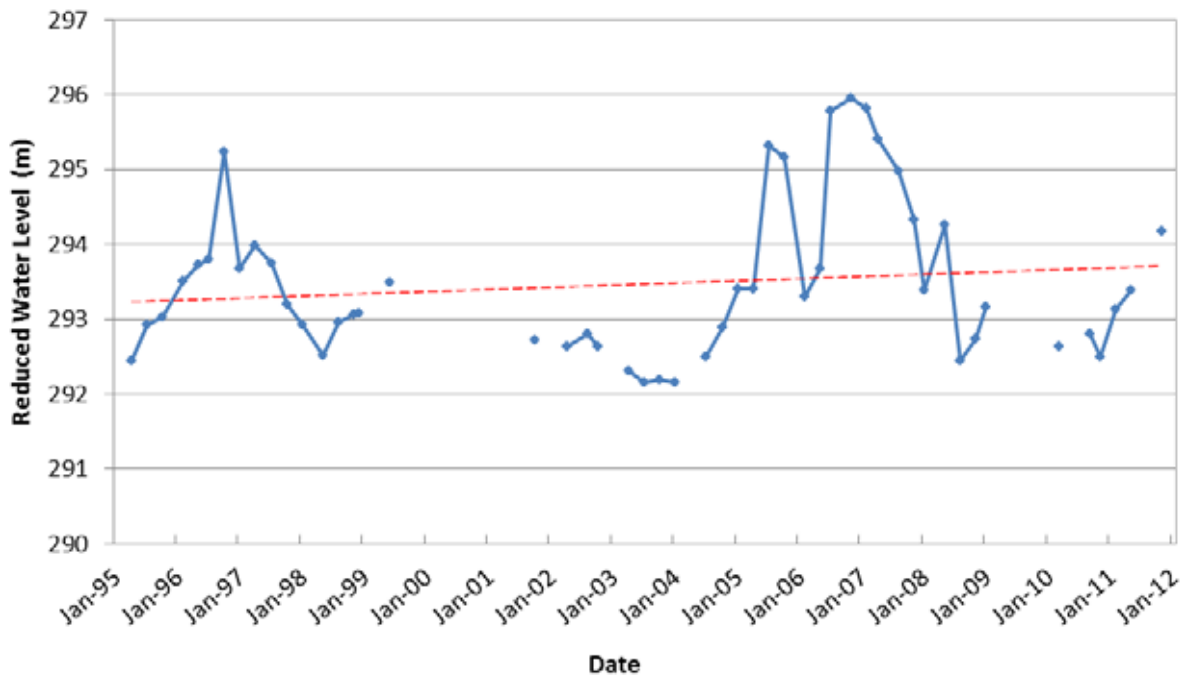


Bore 4007 water quality graphs

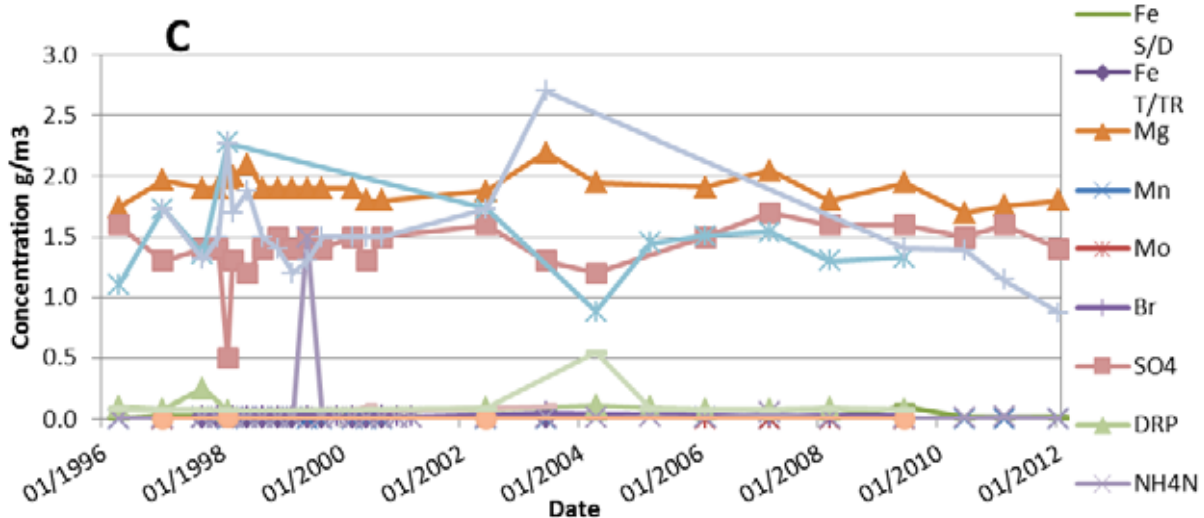
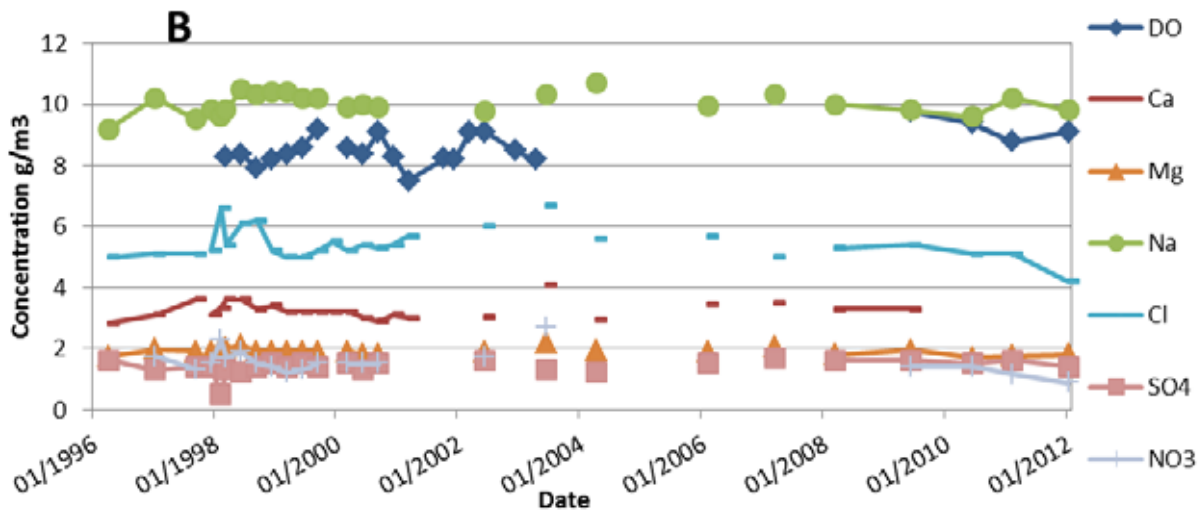
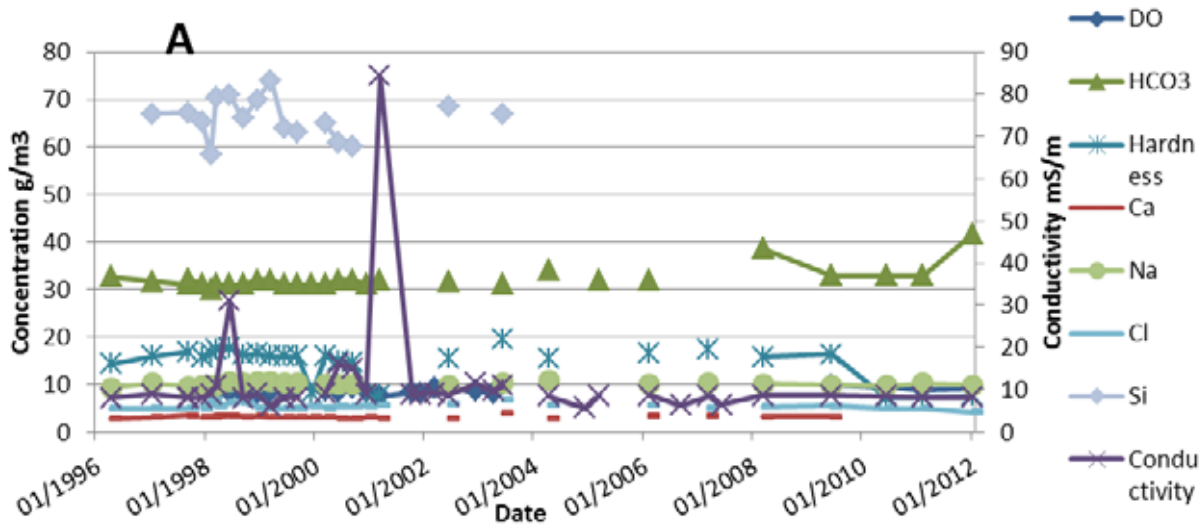


Bore 4364 Information			
Monitoring type	Water quality	Depth (m)	177
Name	Fernland Spa	Casing Depth (m)	-
Bore use	Commercial	Screen/open hole	Open hole
Easting	278 5622	Temperature	37.4
Northing	638 3676	Catchment	
Bore log	Complete	Aquifer	Waiteariki (WAI)
Monitoring period	Water level		
	Water quality	1996 to 2011	LabStar: BOP180062

Bore 4364 geological profile (EBOF)

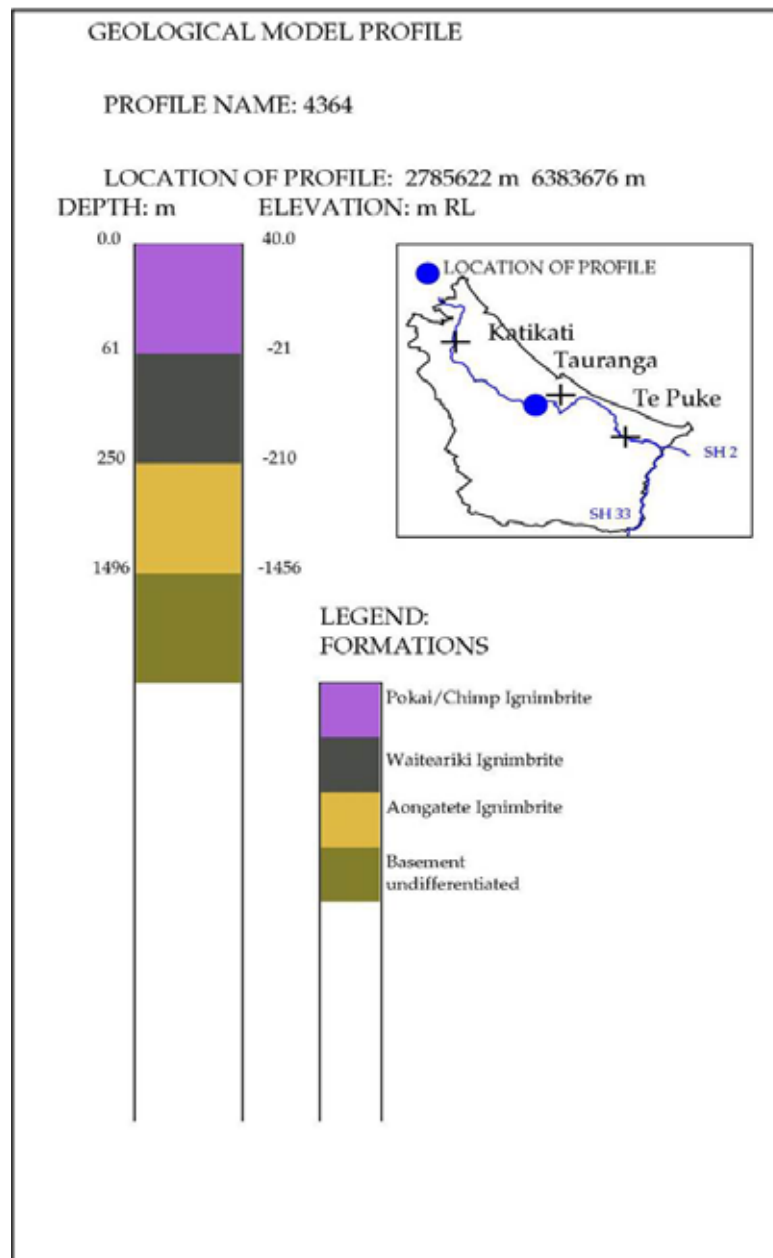


Bore 4364 water quality

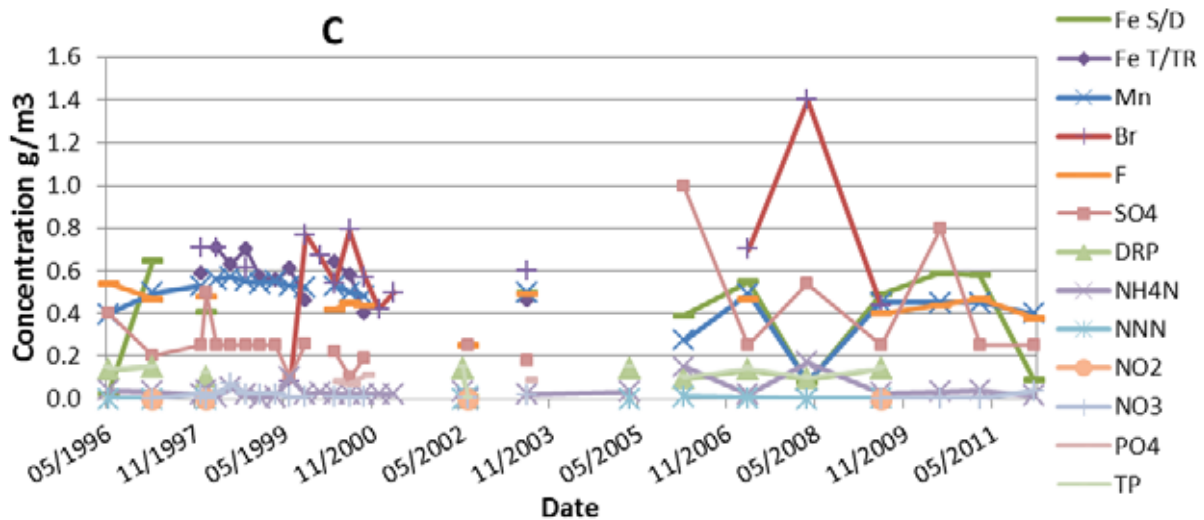
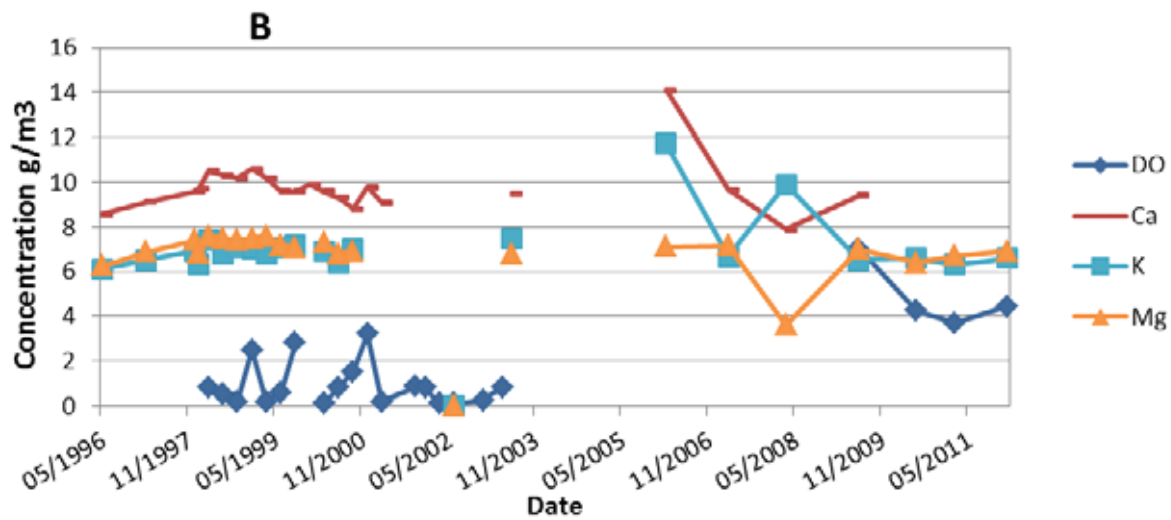
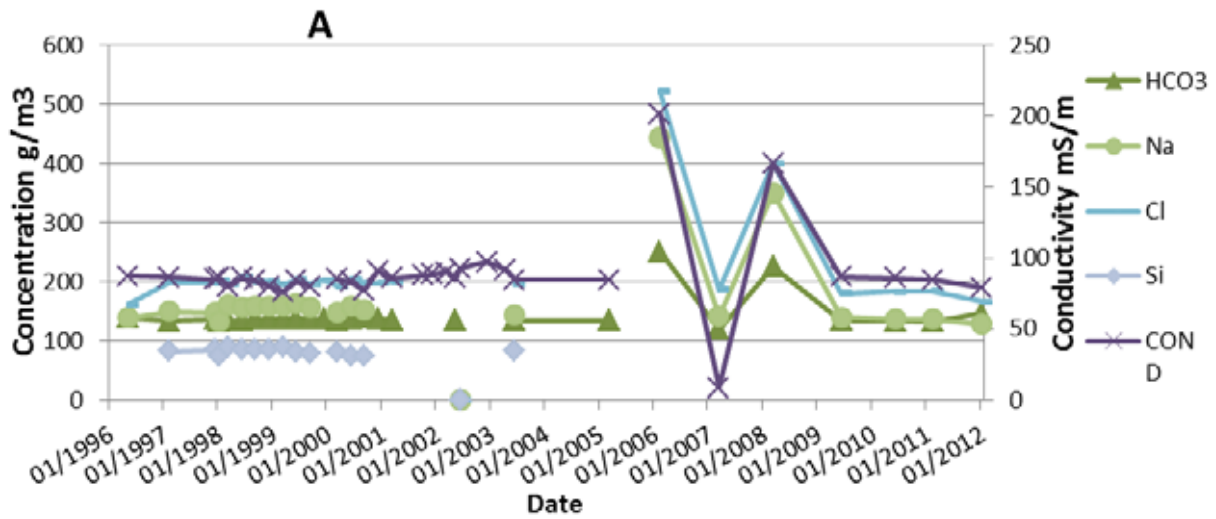


Bore 4582 Information			
Monitoring type	Water quality	Depth (m)	350
Name	MacLean	Casing Depth (m)	Unknown
Bore use	Unknown	Screen/open hole	Open hole
Easting	279 3910	Temperature	26.7°C
Northing	638 2080	Catchment	Welcome Bay
Bore log	–	Aquifer	Aongatete (WAI)
Monitoring period	Water level		
	Water quality	1997 to 2008	LabStar: BOP180069

Bore 4582 geological profile (EBOF)

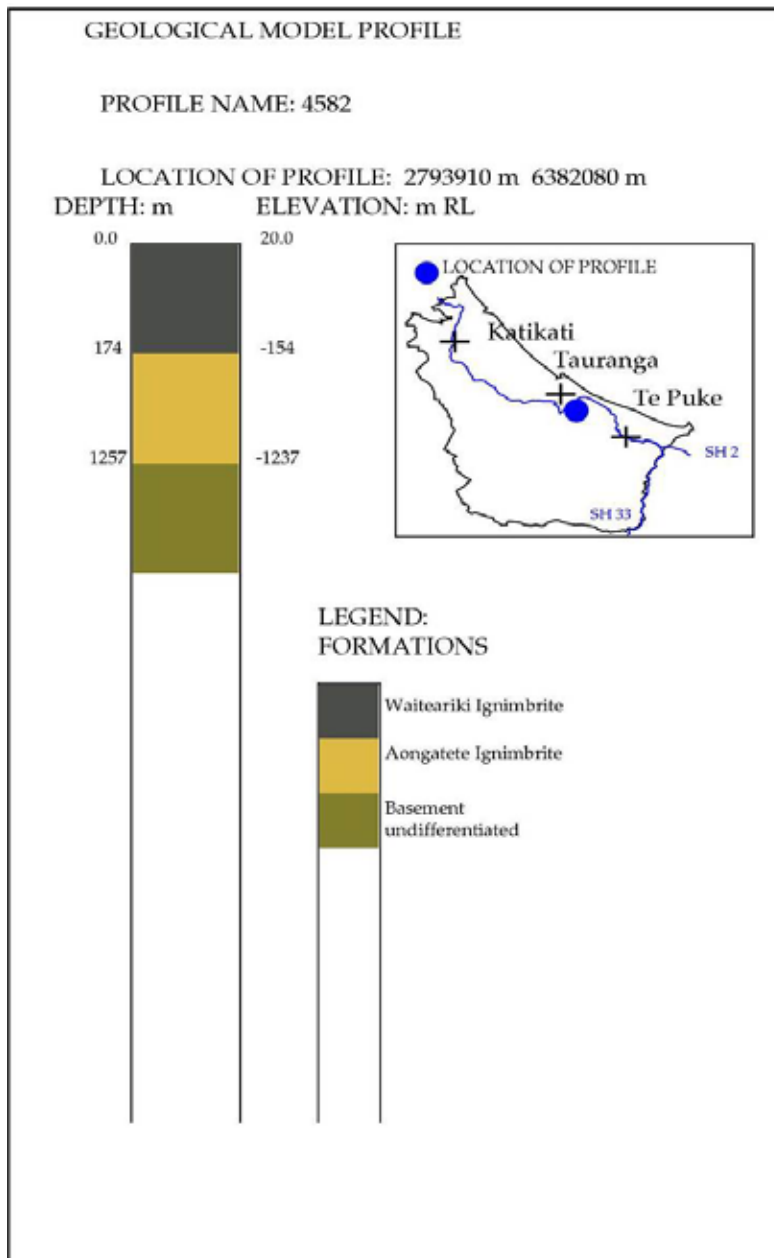


Bore 4582 water quality graphs

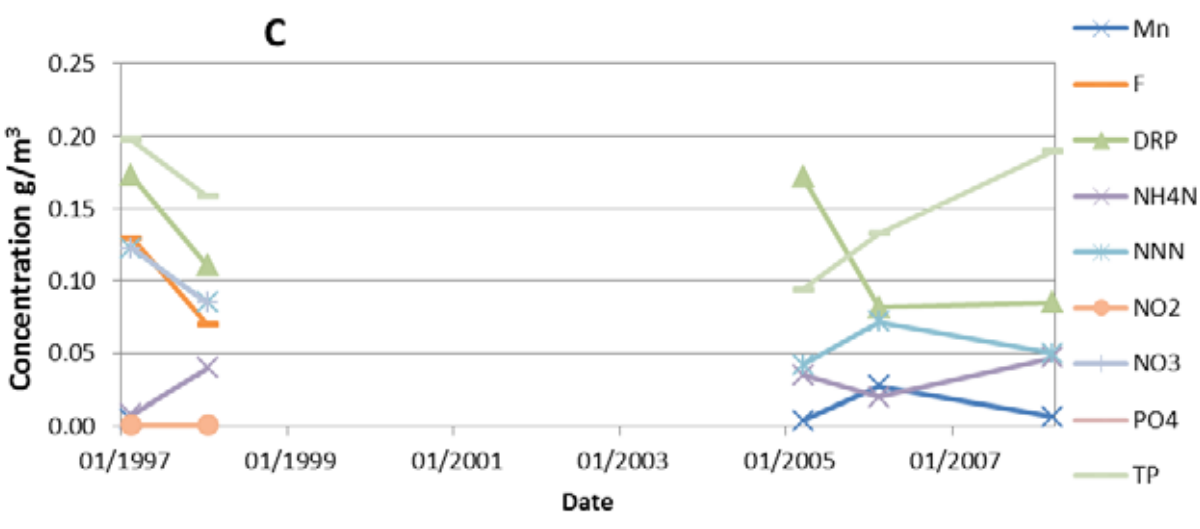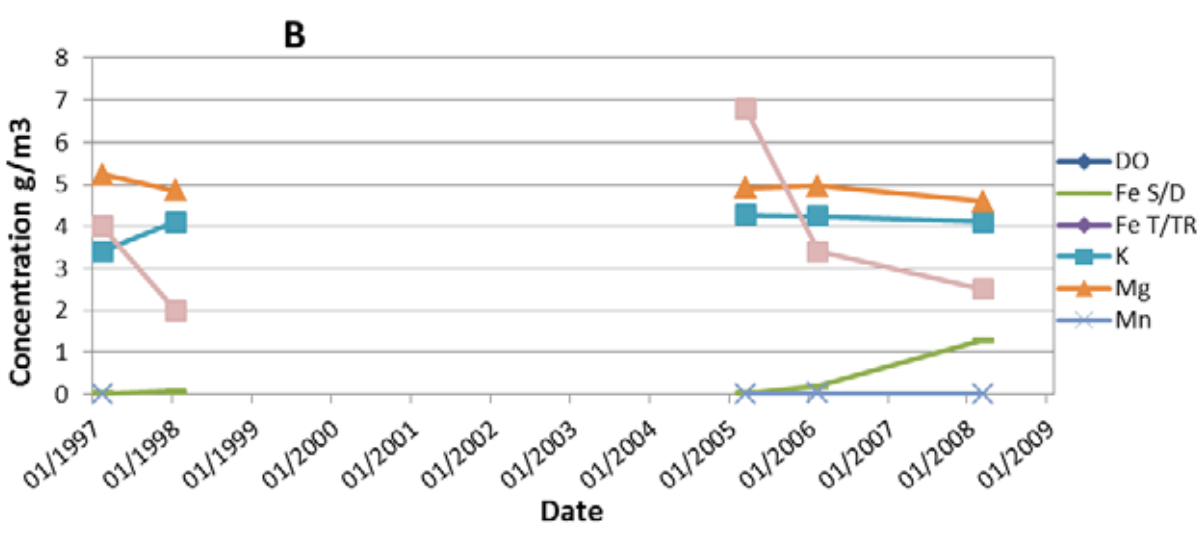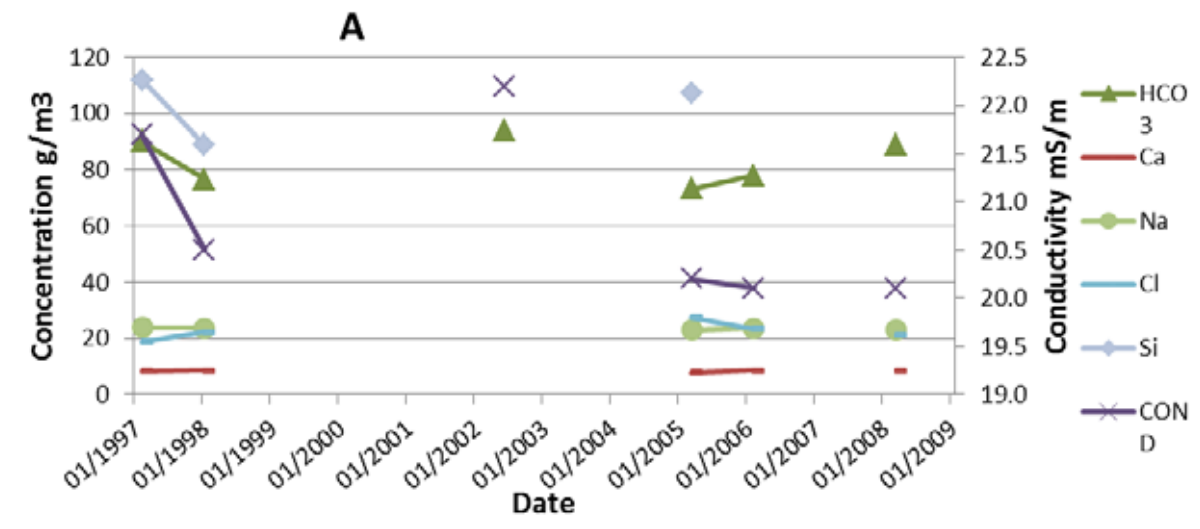

Bore 4968 Information			
Monitoring type	Water quality	Depth (m)	10
Name	Wharenui Green Ltd.	Casing Depth (m)	unknown
Bore use	Irrigation/frost	Screen/open hole	unknown
Easting	2816567	Temperature	-
Northing	6365568	Catchment	Kaikokopu- Pokopoko-Wharere
Bore log	-	Aquifer	Tauranga sediments
Monitoring period	Water level	-	
	Water quality	2002 to 2011	LabStar: BOP180406

Bore 4968 geological profile (EBOF)

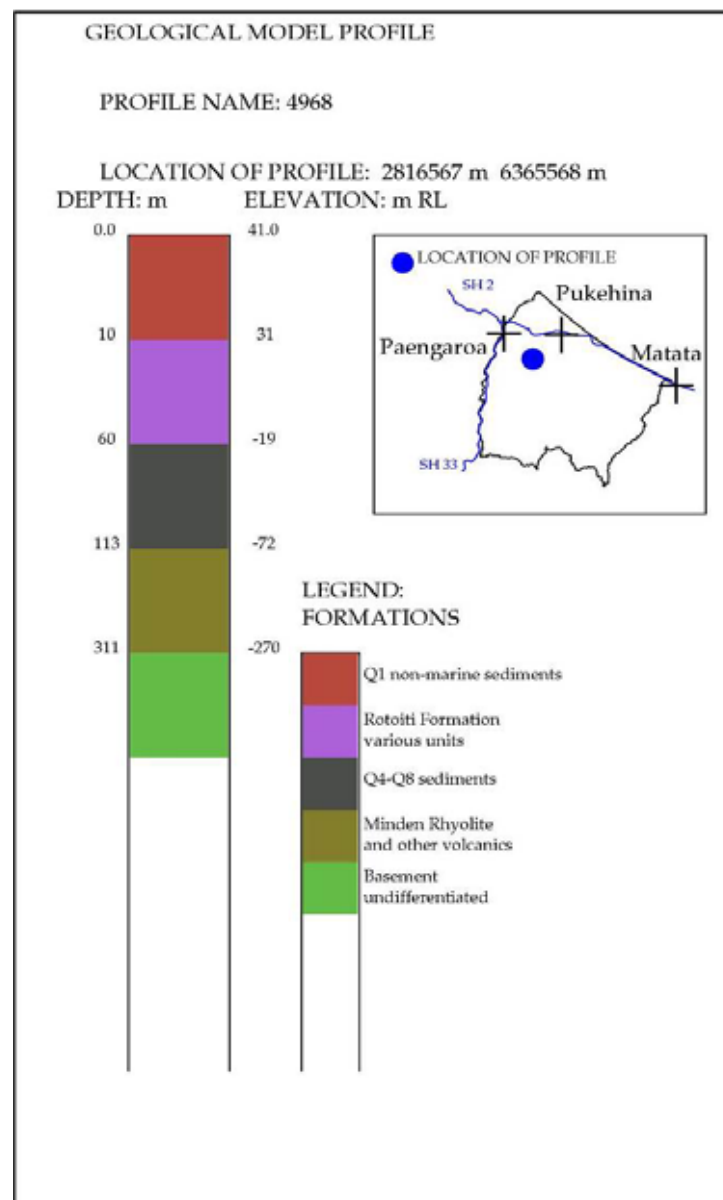

Bore 4968 water quality graphs

